ASSY NOMENCLATURE: LAUNCHILANDING BRACKETRY

SYSTEM: CREW ESCAPE SYSTEM

REVISION:

ASSY P/N: SGD2710133;

SUBSYSTEM: POLE CREW ESCAPE SYSTEM

" PAGE 13 OF 70

			T	T		
FA	FMEA	NAME,QTY &	CRIT'Y	FAILURE MODE AND CAUSE	FAILURE EFFECT ON	
REF	REV	DRAWING REF DESIGNATION	CHITY		END ITEM	RATIONALE FOR ACCEPTANCE
2.1.2		PIP PIN STARBOARD SIDE UPPER/LOWER FITTINGS (2), SED27101402, SED27101403	1/1	2.1.2 Mode: Starboard fitting pip pin fails, releasing one altachment point of the pole Cause: Contamina- tion Ball detent fails Vibration	Loss of pole attachment to Orbiter, releasing pole in middeck	1. Design Features. The design features which minimize the probability of this failure mode are: a. The pin is manufactured in accordance with MIL-STD-17984. The shank, spindle, handle, retention balls, collar, and spring of the pin are fabricated from corrosion resistant steel. The components are passivated after fabrication. b. The pin is a single acting, self-retaining device which employs pin retention balls that recess only when the release button is depressed. The 0.5 inch diameter pin is 0.01 inch smaller than the diameter of the fitting bushings through which the pin is inserted. The tip of the pin is chamfered which serves as an aid in its installation. c. The location and alignment of the fitting bushings/bearings are defined by the engineering drawings. The bushings are press fit to prevent misalignment. The starboard fitting is designed with a -0.5 to + 1.0 inch "slip" to accommodate Orbiter vehicle expansion or contraction. d. A spare, identical pin is carried in the Orbiter crew cabin for use in reinstalling the PCES for lunding phases in the event the primary pin should fail. e. The pip pin was designed to a safety factor of 1.4.

ATTACHMENT Page 58 of

ASSY NOMENCLATURE: LAUNCHILANDING BRACKETRY

SYSTEM: CREW ESCAPE SYSTEM

REVISION:

ASSY P/N: SGD27101333

SUBSYSTEM: POLE CREW ESCAPE SYSTEM

PAGE 14 OF 70

'	MEA	NAME,QTY &	enitty.	FAILURE MODE AND CAUSE	FAILURE EFFECT ON	
REI	REV	DRAWING REF DESIGNATION	CRIT'Y		ENDITEM	RATIONALE FOR ACCEPTANCE
2 1	2	PIP PIN STARBOARD SIDE UPPER/LOWER FITTINGS (2), SED27101402, SED27101403	1/4	2.1.2 Mode: Starboard fitting pip pin fails, releasing one attachment point of the pole Cause: • Contamina- tion • Ball detent fails • Vibration	Loss of pole attachment to Orbiter, releasing pole in middeck	2. Testing/Analyses. a. Acceptance Tests. (1) Acceptance vibration lest (AVT) • Duration: 3 minutes/axis • Levels: 20 - 80 Hz, increasing 3dB/Octave 80 - 350 Hz at 0 08g/Hz 350 - 2000 Hz, decreasing 3dB/Octave (2) Functional test (prior to and after AVT). • Initial process, controlled PCES deployment and recocking • Noncontrolled deployment with equivalent aerodynamic loads on pole tip • Manual deployment with ratchet assembly b. Certification Tests (These tests were performed at the system level.) (1) Qualification acceptance vibration tests (QAVT). • Duration: 5 times AVT, 15 minutes/axis • Levels: 20 - 80 Hz, increasing 3dB/Octave 80 - 350 Hz, at 0 067g?/Hz 350 - 2000 Hz, decreasing 3dB/Octave (2) Functional test (after QAVT). • Controlled deployment and recocking of PCES • Noncontrolled deployment with equivalent aerodynamic loads on the pole tip

PREPARED BY. R. HEISKALA

SUPERSEDING DATE:

APPROVED BY . T. PELISCHEK

DATE

S9 of

ASSY NOMENCLATURE: LAUNCHILANDING BRACKETRY

SYSTEM: CREW ESCAPE SYSTEM

REVISION:

ASSY P/N: SGD27101333

SUBSYSTEM: POLE CREW ESCAPE SYSTEM

PAGE 15 OF 70

FA	FMEA	NAME,QTY &	 	FAILURE MODE AND CAUSE	PARURE EFFECT ON END-ITEM	
REF	REV	DRAWING REF DESIGNATION	CRIT'Y			RATIONALE FOR ACCEPTANCE
2.1.2		PIP PIN STARBOARD SIDE UPPER/LOWER FITTINGS (2), SED27101402, SED27101403	1/1	2.1.2 Mode: Starboard fitting pip pin fails, releasing one attachment point of the pole Cause: Contamina- tion Ball detent fails Vibration	Loss of pole attachment to Orbiter, releasing pole in middeck	(3) Flight random vibration tests, 48 minutes/axis, in 4 segments as follows:

ASSY NOMENCLATURE: LAUNCHILANDING BRACKETRY

SYSTEM: CREW ESCAPE SYSTEM

REVISION:

ASSY P / N: SGD27101333

SUBSYSTEM: POLE CREW ESCAPE SYSTEM

PAGE 16 OF 7

FMEA		NAME,QTY &		FAILURE MODE		PAGE 16 OF 70
REF	REV	DRAWING REF DESIGNATION	CRIT'Y	AND CAUSE	END ITEM	RATIONALE FOR ACCEPTANCE
212		PIP PIN STARBOARD SIDE UPPER/LOWER FITTINGS (2), SED27101402, SED27101403	1/1	2.1.2 Mode: Starboard fitting pip pin fails, releasing one attachment point of the pole Cause: Contamina- tion Ball detent fails Vibration	Loss of pole attachment to Orbiter, releasing pole in middeck	(7) Fungus (by analysis). Non-nutrient to fungi in accordance with MIL-STD-810D, method 508.3 or materials adequately treate (refer to MF0004-014C, paragraph 3.1.1 c.) (8) Humidity (by analysis). The PCES materials list was analyzed to certify compliance with MF0004-014, paragraph 3.1.1 e. (9) Salt spray (by analysis). The PCES materials list was analyzed to certify compliance with MF0004-014, paragraph 3.3.3.7. (10)Sand/dust (by analysis). Sand Dust diameter 0.0031 to 0.039 inches suspended sand 1.2 lbs. per cubic ft. wind speed 33 ft/sec hardness 7 to 8 Moh scale 11)Additional certification tests/analyses. Transportation - packaging, shock, and vibration: Packaging designed and protective procedures developed in accordance with FED-STD-101 On/off cycle life test (by testing): PCES deployed 20 times, refer to (4) above Transtent vibration (by analysis) Structural fatigue (by analysis) Corrosion: (by analysis) Handling shock, crash shock, and landing shock (by analyses) Acceleration and cabin atmosphere (by analysis) Full life and limited life certification (by analysis)

PREPARED BY. R. HEISKALA

SUPERSEDING DATE:

APPROVED BY. T. PELISCHEK

DATE

----- 0 H₃

Uī

REVISION:

PAGE 17 OF 70

FA	FMEA	NAME,QTY &		FAILURE MODE AND CAUSE	FAILURE EFFECT ON	
REF	REV	DRAWING REF DESIGNATION	CRIT'Y			RATIONALE FOR ACCEPTANCE
J.		PIP PIN STARBOARD SIDE UPPER/LOWER FITTINGS (2), SED27101402, SED27101403	1/1	2.1.2 Mode: Starboard fitting pip pin fails, releasing one attachment point of the pole Cause: • Contamina- tion • Ball detent fails • Vibration	Loss of pole attachment to Orbiter, releasing pole in middeck	C. Turnaround Testing The PCES end item is removed after each flight and the pip pin is visually inspected, per OMRSD requirements, prior to reinstallation for each mission. 3. Inspection/QA/Manufacturing. a. All PCES fabrication, assembly, and test activities were performed under the jurisdiction of the NASA ISC Quality Assurance (QA) Division in accordance with ISCM 5312 SR&QA Manual Requirements. QA surveillance was provided for procurement, planning, processing, fabrication, assembly, certification testing, and acceptance lesting. One hundred percent mandatory inspection points were employed at appropriate points in the fabrication, assembly and acceptance process. b. Receiving inspection verified that the correct pins were procured as identified by the design drawings and on the procurement documents, and that data was provided attesting to the traceability and acceptability of materials and components used in their manufacture. c. QA inspections verified: (1) Supplier data attesting to use of correct, approved materials (2) Dimensional tolerances specified on design drawings (3) Absence of burrs and sharp edges (4) Maintaining cleanliness in accordance with ISC Manual 5322, paragraph 7 1 3 to level GC (5) Proper installation and function of the pins in PCES assemblies (6) PCES packaging prior to shipment to ensure the pin is protected from damage (7) A H (8) A (9) C (10) C H (11) C H (12) C C (13) C C (14) C C (15) Proper installation and function of the pins in PCES assemblies

CRITICAL ITEMS LIST ASSYP/N: SGD27101333

ASSY NOMENCLATURE: LAUNCHILANDING BRACKETRY

SYSTEM: CREW ESCAPE SYSTEM

REVISION:

SUBSYSTEM: POLE CREW ESCAPE SYSTEM

PAGE 18 OF 70

FM	EA	NAME,QTY & DRAWING REF DESIGNATION		FAILURE MODE	FAILURE EFFECT ON	RATIONALE FOR ACCEPTANCE
REF	REV		CRIT'Y	AND CAUSE	ENDITEM	
2.12		PIP PIN STARBOARD SIDE UPPER/LOWER FITTINGS (2), SED27101402, SED27101403	W	2.1.2 Mode: Starboard fitting pip pin fails, releasing one attachment point of the pole Cause: • Contamina- tion • Ball detent fails • Vibration	Loss of pole attachment to Orbiter, releasing pole in middeck	d. Turnaround. The PCES end item is removed after each flight and the pip pin is visually inspected, per OMRSD requirements, prior to reinstallation for each mission. 4. Failure History. The pip pin is an off-the-shelf item, with no ALERTS and no failure history for this application. 5. Operational Use. a. Operational Effect of Failure Probable loss of crew. b. Crew Action. None. c. Crew Training Not applicable. d. Mission Constraints. None. e. In-Flight Checkout. None.

PREPARED BY: R. HEISKALA

SUPERSEDING DATE:

APPROVED BY: T. PELISCHEK

DAIL

J